
Fig. 1134, 1190 Hex Locknut & Floor Flange (Class 150 Standard)

General Assembly of Threaded Fittings

1 Inspect both male and female components prior to assembly.

- Threads should be free from mechanical damage, dirt, chips and excess cutting oil.
- Clean or replace components as necessary.

2 Application of thread sealant

- Use a thread sealant that is fast drying, sets-up to a semi hard condition and is vibration resistant. Alternately, an anaerobic sealant may be utilized.
- Thoroughly mix the thread sealant prior to application.
- Apply a thick even coat to the male threads only. Best application is achieved with a brush stiff enough to force sealant down to the root of the threads.

3 Joint Makeup

- For sizes up to and including 2" pipe, wrench tight makeup is considered three full turns past handtight. Handtight engagement for ½" through 2" thread varies from 4½ turns to 5 turns.
- For 2½" through 4" sizes, wrench tight makeup is considered two full turns past handtight. Handtight engagement for 2½" through 4" thread varies from 5½ turns to 6¾ turns.



asc-es.com

Building connections that last™